# Thermodynamic Steam Traps - 662

# تاسيسات بغار اصفهان 021 66479486 0912 8448763

# Description

This type is a maintainable thermodynamic steam trap. The 662 is specifically designed for relatively small condensate loads and therefore is ideal for mains drainage applications.

Note: The Integral Blow-down valve is an assembly designed to be fitted to 662 Thermodynamic steam traps as an extra option.



## **Limiting Conditions**

Maximum Body Design Conditions	PN63	
PMO - Maximum Operating Pressure	42 kgf/cm²	
TMO - Maximum Operating	400 °C	
Temperature		
PMOB – Maximum Operating Back	75% of Inlet	
Pressure - not exceed	Pressure	
Minimum Operating Differential	1 kgf/cm²	
Pressure for Satisfactory Operation		
PMA - Maximum Allowable Pressure	63 kgf/cm <sup>2</sup>	
TMA - Maximum Allowable Temperature	400 °C	
Cold Hydraulic Test Pressure	95 kgf/cm²	

#### **Operating Range**

△PMX - Maximum differential pressure 42 kgf/cm²


#### Sizes and Pipe Connections

 $\frac{1}{2}$  ",  $\frac{3}{4}$ " and 1" Screwed (ANSI B1.20.1) - Socket Weld (ANSI B16.11)

## Dimensions / Weights (Approximate) mm and kg

Size	Α	В	C	Weight
1/2"	75	80	78	0.8
3/4"	80	90	88	1.0
1"	85	90	98	1.5

Constructions are a bit different according the sizes.

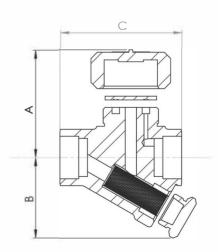



# Thermodynamic Steam Traps - 662


021 66479486 0912 8448763

فروش

#### **Materials**


No.	Part	Material
1	Body	AISI 420
2	Disc *	AISI 420
3	Сар	AISI 420
4	Strainer Screen *	AISI 304/316
5	Strainer Cap	AISI 420
6	Name Plate	ALUMINUM
7	Blow-Down Cap **	AISI 420
8	Blow-Down Screw **	AISI 420

Note: (\*) Spare Part (\*\*) Optional extra

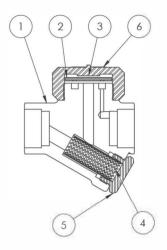

## **Capacities**

Maximum continual discharge amount (kg/h)

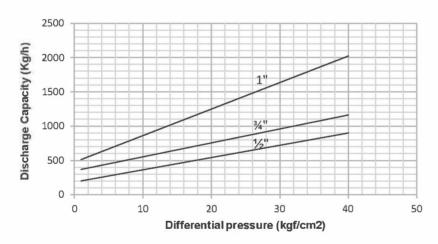

#### Installation

The trap should preferably be installed in the horizontal plane, with a small drop leg preceding it. Where the trap discharges into a closed return system, a non-return valve should be fitted downstream to prevent return flow. Ensure all connection ports are clear from obstruction. Always open isolation valves slowly until normal operating conditions are achieved. This will avoid system shocks. Check for leaks and correct operation. Always ensure the correct tools, safety procedures and protective equipment is used at all times.

#### How to Order

Example: TD662 1/2", Thermodynamic Steam Trap Screwed with Blow-down Valve.